

Date: **January, 1989**Model: **APR-5000 SERIES**Serial No: **10,001 AND HIGHER**Subject: **PROPER RECONNECTION OF PDB
BOARD CONNECTOR****DESCRIPTION**

Care must be used to properly reconnect plug CNP 910 to CNJ 910 on the PDB Board because the plug and jack are not keyed. The following symptoms are likely when CNP 910 is not properly connected to CNJ 910:

- All ALN panel LEDs will be on
- Meter bridge and keypad LEDs may be on
- The CPU power-on diagnostic routine will freeze at the software version number (i.e. "P.4.01.01.1").

Units with serial numbers 10,001-19,999 have no identifying marks on CNJ 910 or CNP 910. Mark corresponding points on CNJ 910 and CNP 910 before disconnection.

Units with serial numbers 20,001 and higher have white arrows on the underside of CNJ 910 and CNP 910 that must be aligned for proper reconnection.